



School District of Philadelphia  
Office of Environmental Management Services  
440 North Broad St.  
Philadelphia, PA 19030

Originally Requested by: Principal Kaplan

Date Inspected:  
12/1/16

Inspector Name: Brian Joseph  
Company: KEM Partners

# Asbestos Design Data Collection (DDC)

(Revision 8/8/2013)

Date Issued to OEMS:  
12/2/16

Photographs Attached: Yes  
Sketch(s) Attached: No

Name of Building: Jackson Elementary School

Address: 1213 S. 12<sup>th</sup> Street ULCS # 2510

Work Area Location(s): (1) Room 203 Closet (2) Room 102 Closet

Total Number of Work Locations: 1 Anticipated Project Duration: 2 Man-days

Project Total: Material(s)/Quantity: ACPI/ 24 LF Work Order # \_\_\_\_\_

Work Location (1): Room 203 Closet				Imminent Hazard : Yes <input type="checkbox"/> No <input type="checkbox"/>			
Material(s) Requiring Abatement	Confirmed or Assumed (if assumed follow the assumed material directive)	Total Amount Present (LF or SF)	Amount with Damage (LF or SF)	Suggested Amount for Abatement Action (LF or SF)	Type of Abatement* (codes below)	Friable or Non-Friable Removal	Reason for Abatement
ACPI	12 LF	12 LF	0	12 LF	RMV	FRI	Removal needed to allow for plaster repair
Visible Debris (Yes or No)	Water or Steam Leak	Water or Steam Leak Isolated (Yes or No)	Student / Teacher Occupied (Yes or No)	Confined Space (Yes or No)	Work Area Securable (Yes or No)	Height of Ceiling (feet)	Height of Material (feet)
No	No	N/A	Yes	No	No	12	12
Type of Ventilation	Type of Ceiling	Type of Floor Substrate	Multiple Layers	Pipe Diameter (inches)	Fixed Objects	Movable Objects	Time Accessible
Radiant Heat/Window	Plaster	wood	N/A	1"	N/A	contents	3 PM
Location of Water	Location of Electricity	Location of Decontamination Shower	Location of Exhaust Air Discharge	Volume of Containment Area (ft <sup>3</sup> )	Other ACM in Work Area (list material)		
Bathroom	Room 210	N/A	window	800	unknown		

- **Equipment Needed:** HEPA Vacuum:  Air Filtration:  Critical Barriers:  Ladders:  Scaffolding:
- **Project Classification:** Incidental  Small  Minor  Major  Non-Friable
- **Project Sampling:** On-Site Analysis  Within 24 Hours
- **Alternative Method Required:** Yes  No  Describe: \_\_\_\_\_

If applicable, the API Firm should work with OEMS on the Alternative Method Request for all Friable Projects.

\*Remediation Codes: RMV (remove), REP (repair), ENP (encapsulate); RPL (replace)

Signature: Brian Joseph

Date: 12/2/16

Work Location (2): Room 102 Closet				Imminent Hazard : Yes <input type="checkbox"/> No: <input type="checkbox"/>			
Material(s) Requiring Abatement	Confirmed or Assumed (if assumed follow the assumed material directive)	Total Amount Present (LF or SF)	Amount with Damage (LF or SF)	Suggested Amount for Abatement Action (LF or SF)	Type of Abatement* (codes below)	Friable or Non-Friable Removal	Reason for Abatement
ACPI	12 LF	12 LF	0	12 LF	RMV	FRI	Removal needed to allow for plaster repair
Visible Debris (Yes or No)	Water or Steam Leak	Water or Steam Leak Isolated (Yes or No)	Student / Teacher Occupied (Yes or No)	Confined Space (Yes or No)	Work Area Securable (Yes or No)	Height of Ceiling (feet)	Height of Material (feet)
No	No	N/A	Yes	No	No	12	12
Type of Ventilation	Type of Ceiling	Type of Floor Substrate	Multiple Layers	Pipe Diameter (inches)	Fixed Objects	Movable Objects	Time Accessible
Radiant Heat/Window	Plaster	wood	N/A	1"	N/A	contents	3 PM
Location of Water	Location of Electricity	Location of Decontamination Shower	Location of Exhaust Air Discharge	Volume of Containment Area (ft <sup>3</sup> )	Other ACM in Work Area (list material)		
Bathroom	Room 210	N/A	window	800	unknown		

- **Equipment Needed:** HEPA Vacuum:  Air Filtration:  Critical Barriers:  Ladders:  Scaffolding:
- **Project Classification:** Incidental  Small  Minor  Major  Non -Friable
- **Project Sampling:** On-Site Analysis  Within 24 Hours
- **Alternative Method Required:** Yes  No  Describe: \_\_\_\_\_

If applicable, the API Firm should work with OEMS on the Alternative Method Request for all Friable Projects.

\*Remediation Codes: RMV (remove), REP (repair), ENP (encapsulate); RPL (replace)

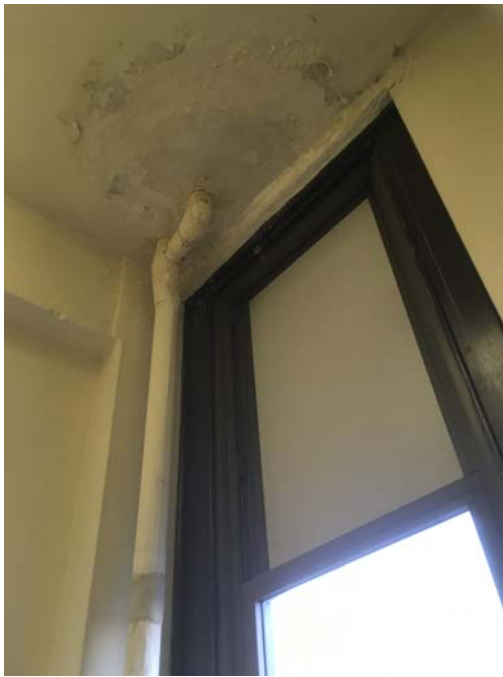


Photo 1 – Room 203 Closet

The insulation on this riser should be removed to allow for paint and plaster repair.



Photo 47 – Room 102 Closet

The insulation on this riser should be removed to allow for paint and plaster repair.

